

Service Note		
Product	Description:	Service note no.
DSP-1 & 2	DSP 1 & 2 clock update	710 10 T016

IMPORTANT:

Modification should only be carried out by authorized technicians.

Symptoms:

The M5000 frame freezes intermittently, or display the message "DSP card not found".

Procedure:

Replace the following components on the lower PCB (M5011-2):

1. Replace IC5 with type 74HCU04 (TC item no: 456000411)
2. Replace C66 with type 47pF, c0805, 5% (TC item no: 253247011)
3. Replace C67 with type 22pF, c0805, 5% (TC item no: 253222011)