

Service Note		
Product	Description:	Service note no.
Wizard	Hardware Corrections for wizards	720 10 T028


Corrections Wizard products:

Type:	#1	#2	#3	#4	#5	#6	#7	#8	#9
M2000 mk 1									
M2000 mk 2	X	X		X			X		
Finalizer									
Finalizer plus	X	X		X					
Finalizer 96k	X	X	X						
Finalizer 96k up/down	X	X	X						
DBMax	X	X		X			X	X	
G-Force	X			X		X	X		
FireworX	X	X		X			X		
Finalizer express	X	X		X			X		
Goldchannel	X	X		X	X		X		
Intonator	X	X	X						
M3000	X	X		X			X		
D22	X	X					X	X	
P2								X	

- #1** Check if IC 8 is ISSI brand. If it is replace IC8 and battery.
- #2** Problems with word clock. Change R296 from 3M3 to 10k.
- #3** Lock problems on S/P-DIF input at 96k. modif. At IC48 (correction sheet 1701).
- #4** Check if IC35, IC36 and IC41 is the right type (33079).
- #5** If version 2 mic amp is mounted always replace with version 5. -If version 3 is mounted look if it is updated (If not replace with version 5).
- #6** Pedal input update correction sheet 1657, 1658. Remember to remove old correction if updating.
- #7** Ic 6 on the PLL-print change to 74AHC00, and the C7 og C13 Change to 56pF.
- #8** Cut outs in the foil where the screws come through the top cover. That must be done before the foil is clued to the top cover according to the enclosed drawing.

Service Note		
Product	Description:	Service note no.
Wizard	Hardware Corrections for wizards	720 10 T028

Check for (including the cover) for loose alu chips.

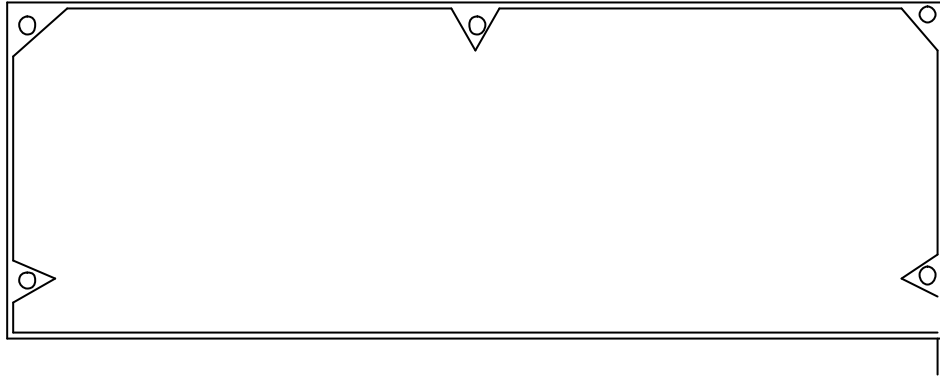

Top cover with stuck on alu foil, with the nescessary cut outs