Service Note		
Product	Description:	Service note no.
FireworX	Modification for Fast Ex. RAM PC12902-3	720 10 T029

IMPORTANT:

Modification should only be carried out by authorized technicians. This modification is ONLY for the type FAST Ex. RAM board, PC12902-3. Do NOT make the modification on board version PC12902-10!!

Symptoms:

The FireworX freezes intermittently or at power on. Or it makes noise.

Procedure:

Locate the Fast Ex. RAM board PC12902-3:

1. Mount a resistor type 4K7 5% as shown at the figure below. Make sure to solder the resistor to the correct pins on the connector.

