

Service Note		
Product	Description:	Service note no.
<b>Finalizer 96</b>	<b>Sample Rate Conversion gives spikes</b>	<b>SNo-T0134</b>

**Reason for note:**


Spikes in the audio output has been reported when using sample rate conversion at any rate.

The error is related to a poor GND connection between PLL board and mainboard.

**Actions:**

If an error which can be linked up with the above mentioned is reported, the following solution must be carried out:

The solution is to solder a 0,28 mm<sup>2</sup> thick wire between the mainboard @ C142 and PLL board @ C35, as shown in the picture.

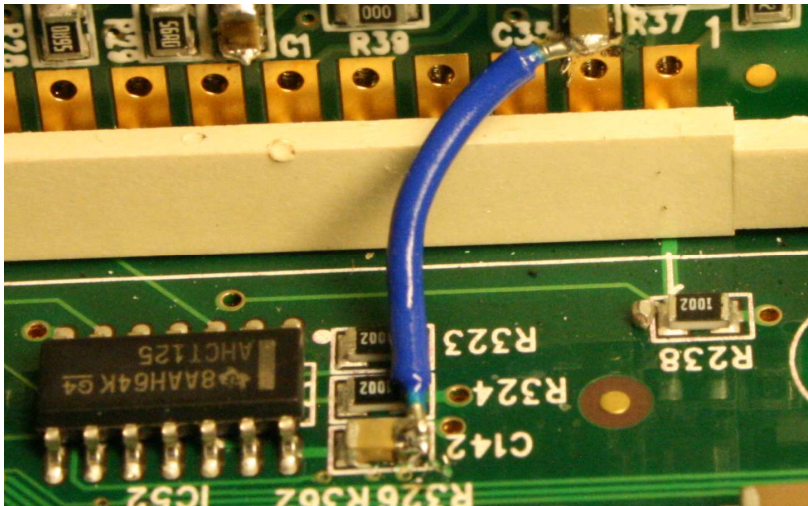

**IMPORTANT:**

This repair should only be carried out by skilled technicians.