

Service Note		
Product	Description:	Service note no.
Finalizer 96K	Pixel error	Sno-T93

Reason for note:

The pixel problem investigated for Reverb 4000 was found to be a potential problem on Finalizer 96K as well. To fix the problem a correction must be made on the PLL board (P12906-5) and a correction must be made on the Mainboard (P13008-C).

Actions:

The following change must be made on the PLL Subboard (P12906-5):

Modify R29 from 0R to 56R

The following change must be made on the Mainboard (P13008-C):

Modify C232 from 100p to NOT_USED

IMPORTANT:

This replacement should only be carried out by skilled technicians.