


| Service Note    |                       |                  |
|-----------------|-----------------------|------------------|
| Product         | Description:          | Service note no. |
| <b>SDI card</b> | <b>Resistor added</b> | <b>SNo-T0113</b> |



**Reason for note:**

Some of the SDI cards (HW version 203 – identified by visible Firewire connector on the backplate) have been shipped without the resistor by a mistake. See the picture. If the resistor is missing there is a risk that the DB4/8 frame will see the SDI card as an AES card.

All stock should be checked and the resistor should be mounted if missing. The resistor is a 4700 ohm ¼ Watt.

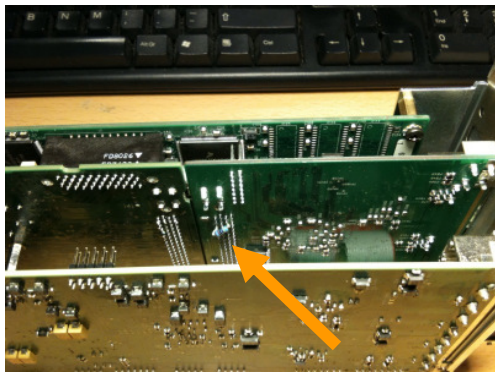

Mounted like this

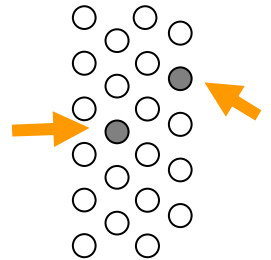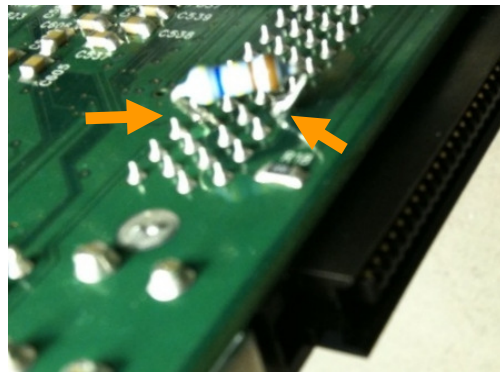

**Actions:**

The resistor shall be mounted if missing. The resistor is a 4700 ohm ¼ Watt.

**IMPORTANT:**

This replacement should only be carried out by skilled technicians.