

<b>Service Note</b>		
Product	Description:	Service note no.
<b>Staccato´51</b>	<b>Tuner out of range. Clicks in sound</b>	<b>SNo-T0121</b>

**Reason for note:**

We have observed a few numbers of Staccato´51 products with problems, which typical gives the following error: Tuner will be out of range, maybe up to one or two tones. Sometimes you can hear clicks in sound. The error is temperature sensitive.

**Actions:**

If a Staccato´51 comes in for repair with this error / these symptoms you have to suspect IC19, which can cause this.

IC19 must be a 74LV00D manufactured by NXP.

**IMPORTANT:**

-