

Service Note		
Product	Description:	Service note no.
TC1280	Modification for Error 57	705 10 03 04

IMPORTANT:

Modification should only be carried out by skilled technicians.

This note concerns units with serial no. between 121032 and 121556.

Symptoms before modification:

The TC1280 shows occasionally Error 57 at power on.

Procedure:

1. Turn Off Power And Disconnect Power Cord.
2. Dismount the bottom lid.
3. Solder in a new diode, type 1N4148, on solder side of the main board, see fig 1. The cathode is connected to IC301 pin 3 and the anode is connected to IC301 pin 12.

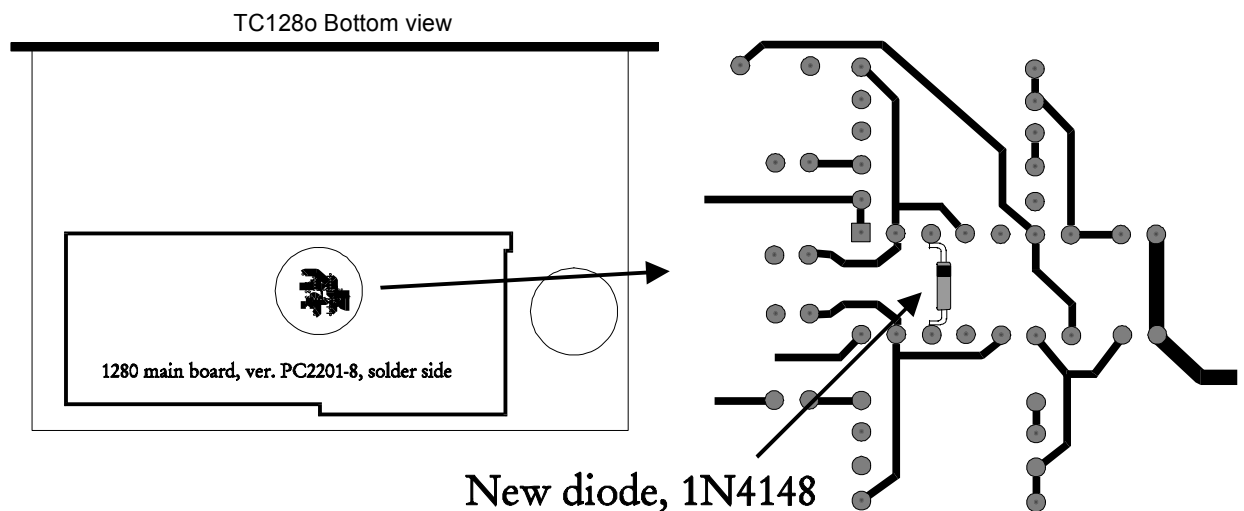


Fig. 1: Modification for Error 57.

4. Mount the bottom lid.
5. Connect power cord and turn on power. The TC1280 might show Error 57 at first power on. That is normal.
6. Now turn power off and on 10 times and make sure no errors show up.