


Service Note		
Product	Description:	Service note no.
TC2290	Updating TC2290 Main Board to FATR/STSA/SA02:	706 10 T069

IMPORTANT: When having 2290s with s.no. lower than 510404 or 510636 for repair or service please make this correction.

Solution:

In connection with FATR/STSA-options there are two more points to be aware of.

1. (2290s with s.no. lower than 510636) jumper R608 must be removed to R606. Just cut out R608.
2. (2290s with s.no. lower than 510404) transistor Q101 (BC547) on main-board must be replaced by a BC547 with a diode in collector.

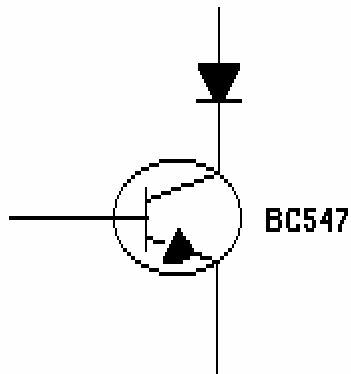

NB! All presets will be lost after this update !!!!!.