TC-IVL Ventures Inc.

Page 1 of 1

Service Bulletin

Date Issued	08 Dec 2000		
Products Covered	VoicePrism		
Issue	Fuses on EU units		
Description	The specified fuse for 220 to 240V is incorrect. Units shipped for European market have incorrect fuse.		
	All VoicePrism units shipped from Vtech or in-transit are affected by the specification changed. ONLY EUROPEAN units need to have the fuse changed.		

Details:

Change for Units Shipped:

1. Add 'TEMP FUSE STICKER' to rear panel of VoicePrism as per figure 1. Stickers are supplied by IVL Technologies.

TOP RIGHT HAND CORNER OF MTL0129

VOLTAGE	FREQUENC	CY FUSE	
100V~		500 mA 250V Slow Blow	
230V~ 240V~			
		ТІ	.25A L

- 2. Print off copy of manual addendum supplied by IVL as a PDF file (Manual Addendum to SUP0065.pdf). Insert the addendum between the front cover and page 1 of the manual.
- 3. If the unit is being sold to a 220 to 240V market change the fuse to IVL part number FUS0011 (1.25A Time Lag, specifically a Littelfuse 218 1.25A)

Future Units: Units yet to leave the factory will be modified to reflect the newly specified fuse. Fuses for European market will be changed. The change will first be done with stickers on the unit and in the manual. When inventory allows the artwork in the manual and on the metal will be changed.

> TC Electronic A/S Sindalsvej 34 DK-8240 Risskov Denmark Phone: +45 8742 7000 Fax: +45 8742 7010 E-Mail: www.service@tcelectronic.com www.tc-helicon.com