

Service Note		
Product	Description:	Service note no.
BM6A MKI V2	BM6A making strange sounds when playing loud.	Sno- T082

Reason for note:

BM6A making strange sounds when playing loud.

The woofer and tweeter moves dramatically when the signal is above a certain level.

The amp is making a buzzing fart :o)

This problem on some of the BM6A mk.I V2 amplifiers is related to a HF feedback due to a faster HEXFET (IRF540N) transistor used in new units.

Actions:

Please replace C21 and C34 from 150pF to 47pF (ceramic capacitor, 2.5mm pitch).
(TC order code: 200247011 47pF 63V 1E Ceramic Plate Capacitor).

IMPORTANT:

This replacement should only be carried out by skilled technicians.