

Service Note		
Product	Description:	Service note no.
BM6A MK I BM15A MK II	Defective relay.	SNo_ T096

Reason for note: It has been discovered that the relay used in the latest version of BM6A MK I and BM15A MK II **V3** can have a bad contact joint resulting in the tweeter being intermittent.

Actions: If a product comes in for service with an error as mentioned the following replacements shall be carried out.

Replace F4AK012T type relay with OSA-SH-212DM5 type. TC stock number: 505007011.

And at the same time the multifuse F5 must be changed from a Bourns MFR-075 type to a Bourns MFR-185 type. TC stock number: 795000001

IMPORTANT:

These replacements should only be carried out by a skilled technician.