

Service Note		
Products	Description:	Service note no.
Nova pedals: Delay, Reverb, Modulator, Repeater	Start up problems w. AC adaptor	SNo-T0159

Reason for note:


We have encountered a problem on a few of the Nova pedals mentioned. The -12V DCDC doesn't start up correctly and forces the 400mA AC adaptor to go into protection mode. The EUT blinks in the LED's but doesn't get up running.

Actions:

If a product comes in with an error like mentioned, it may help to change the following components:

C19, C74, C107 must be changed from 100uF to 47uF, 25V

L2 must be changed from 150uH to 33uH (TC stock no: 7E50201301)

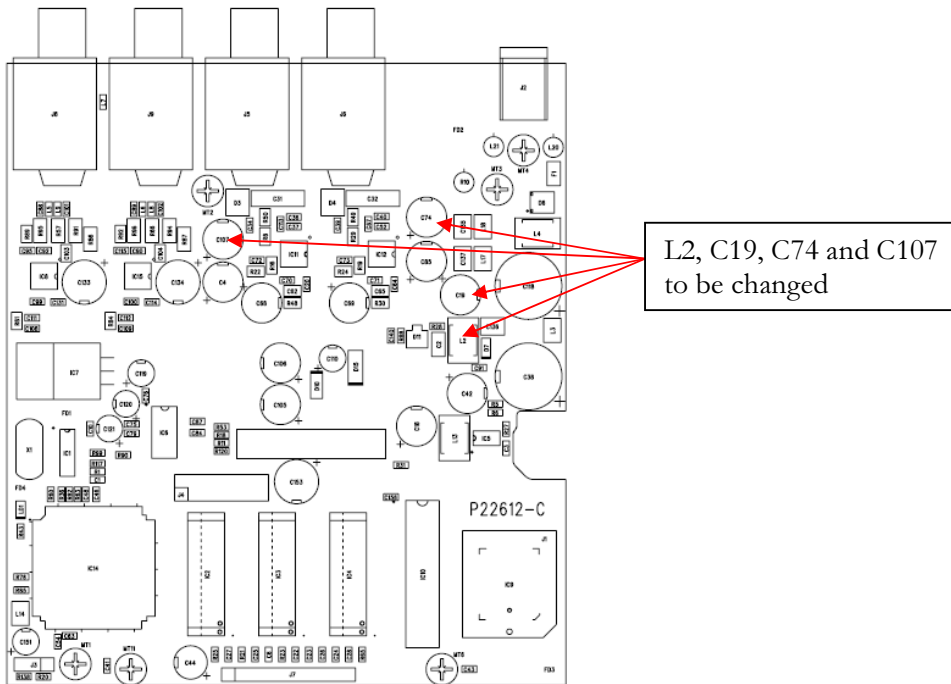

Our tests show that the Nova pedals by this change can handle incoming supplies from 8.5V.

IMPORTANT:

This repair should only be carried out by skilled technicians.