


Service Note		
Products	Description:	Service note no.
VoiceLive Play and VoiceLive Play GTX	Fuse F1 blown	SNo-T0162

Reason for note:

We have encountered a problem on a few VoiceLive Play and VoiceLive Play GTX products. The error has been reported as a blown fuse (F1) when a Power supply unit with other specifications than the matching TC Helicon supply has been used.

Actions:

F1 has to be replaced (TC stock no: 7E39301111, 1A Slo-Blo Fuse 63V-AC/DC 1206). The problem is only seen on the very first production batch, where C25 is a 1000 μ F. This one must furthermore be changed to a 100 μ F (TC stock no: 7E22000701, 100 μ F 20% 63v ELEC.CAP. PCAPR200-400)

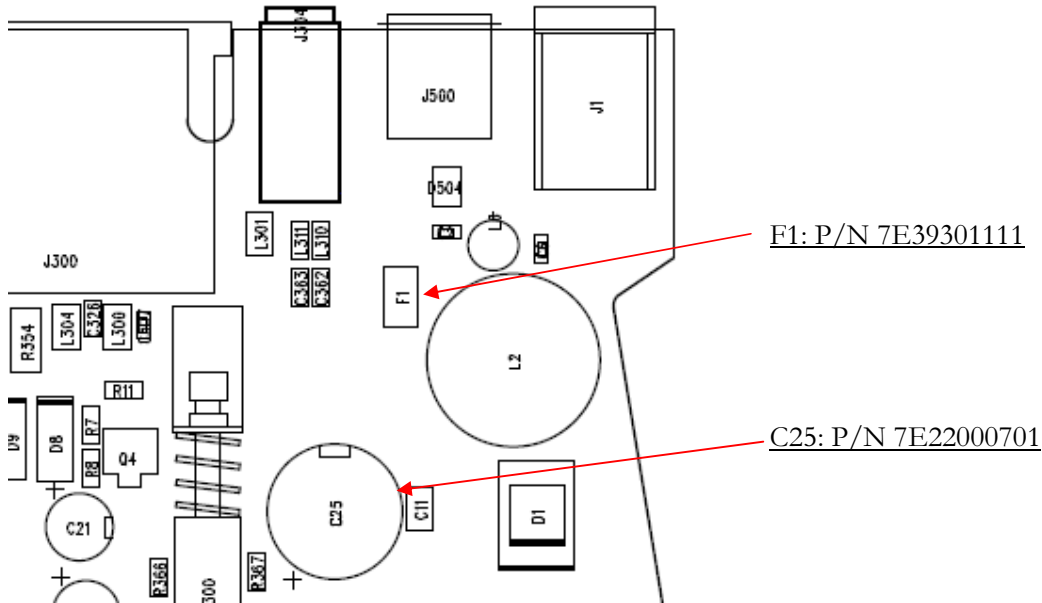

IMPORTANT:

Please handle this repair as a standard repair. This repair should only be carried out by skilled technicians.