Service Note			
Product	Description:	Service note no.	
VoiceLive Touch	Oscillation problems	SNo-T0173	

Reason for note:

Using a long snake will occasionally result in the outputs oscillating. This can happen for PCB revisions DAC, DAD and DAE

Actions:


Changing the values of four resistors (R66, R67, R175, R176) from 39 ohms to 150 ohms on the main board solves this.

A package with 4 resistors is available. Part number is 7E15802199

Where to find the 4 resistors:



Service Note			
Product	Description:	Service note no.	
VoiceLive Touch	Oscillation problems	SNo-T0173	

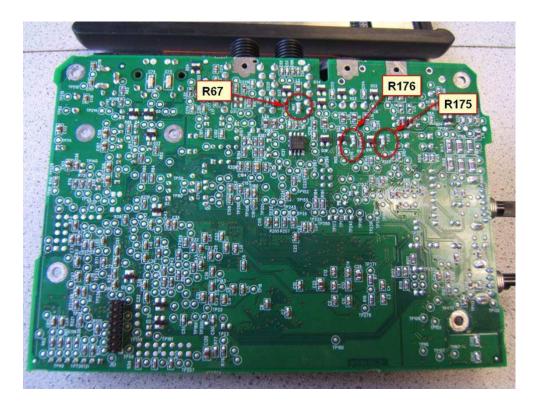

IMPORTANT:

This repair should only be carried out by skilled technicians.