

Service Note		
Product	Description:	Service note no.
VoiceLive Touch 2	USB audio problem	SNo-T0179

Reason for note:

On the first batch of VoiceLive Touch 2 we have seen cases with USB audio problems.

It shows as playback- channel swapping, audio pops, clicks and / or no audio transferring via USB when recording.

Actions:

Changing R432, R434, R435, R436, R437, R513 and R514 from 1K ohms to 82.5 ohms on the main board solves this.

See bottom and top views on the following pages.

IMPORTANT:


Please handle this repair as a standard repair.

This repair should only be carried out by skilled technicians, and only if reported as an error.

Service Note

Product	Description:	Service note no.
VoiceLive Touch 2	USB audio problem	SNo-T0179

VoiceLive Touch 2 bottom view


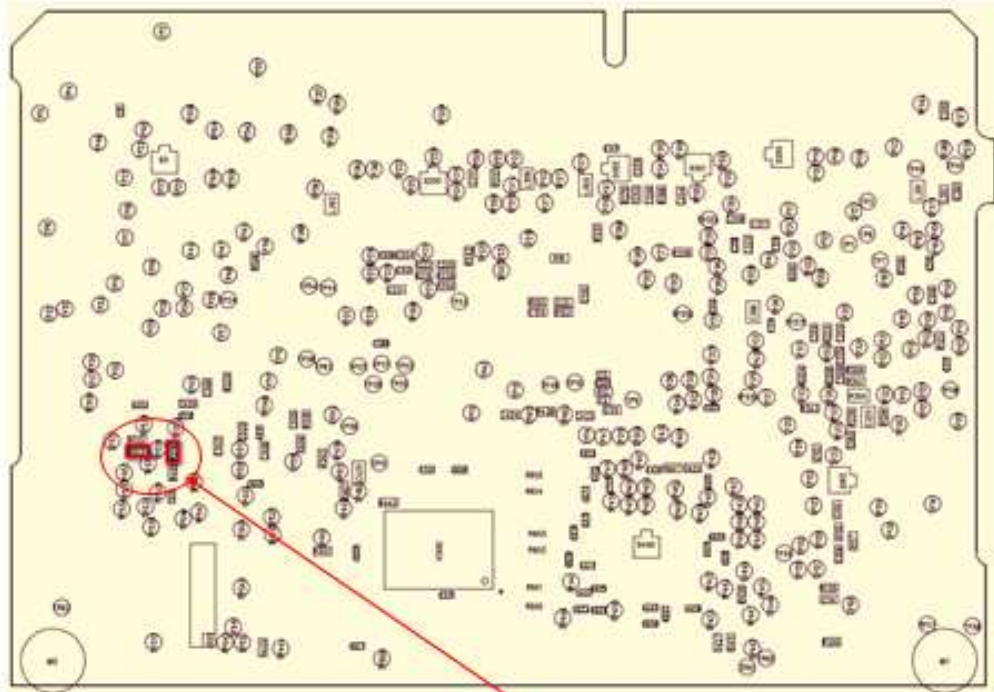


On the bottom side R513 and R514 must be changed from 1 kohm to 82R5

Service Note

Product	Description:	Service note no.
VoiceLive Touch 2	USB audio problem	SNo-T0179

VoiceLive Touch 2 top view

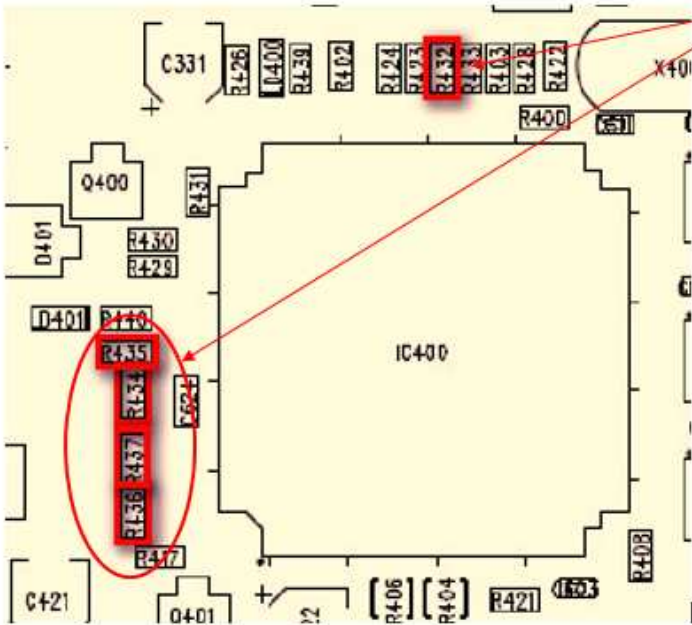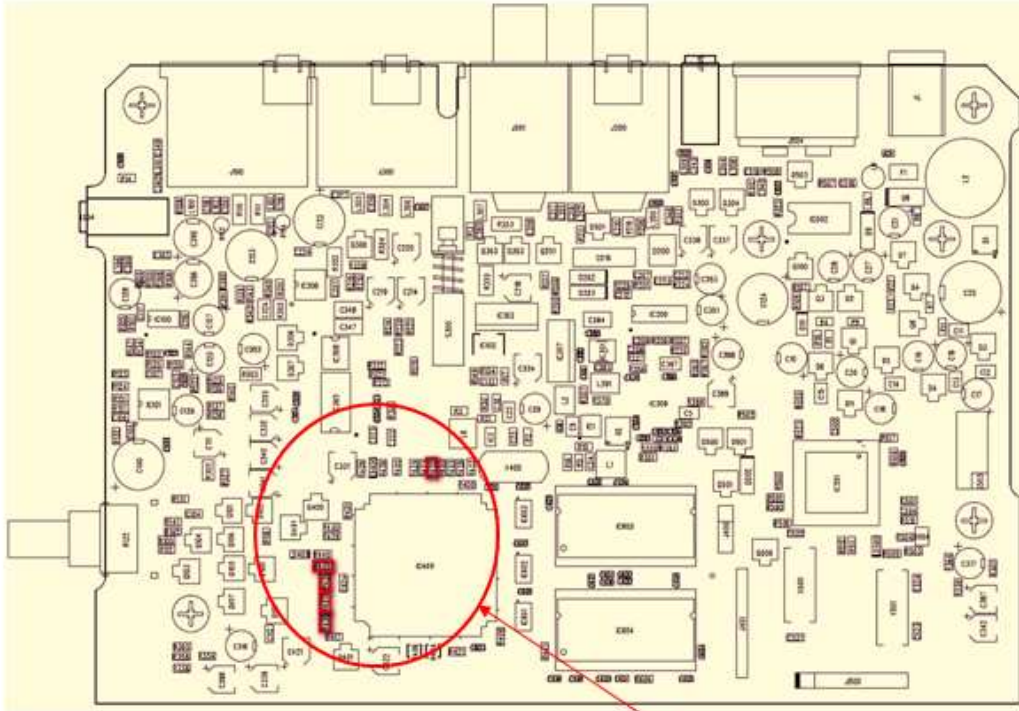

On the top side R432, R434, R435, R436 and R437 must be changed from 1 kohm to 82R5