


Service Note		
Product	Description:	Service note no.
BH250 and BG250 208	Fan is running full speed	SNo-T0193

Reason for note:

We have seen a few incidents where the housing on potentiometer R31 makes a short circuit to the housing of resistor R37. The housing of these resistors are conductive right under the lacquering on the surface . This short circuit is causing the fan to run at full speed right after switching on the product.

Actions:

If you have a product in for service with this issue you have to pay attention to a possible shortcircuit.

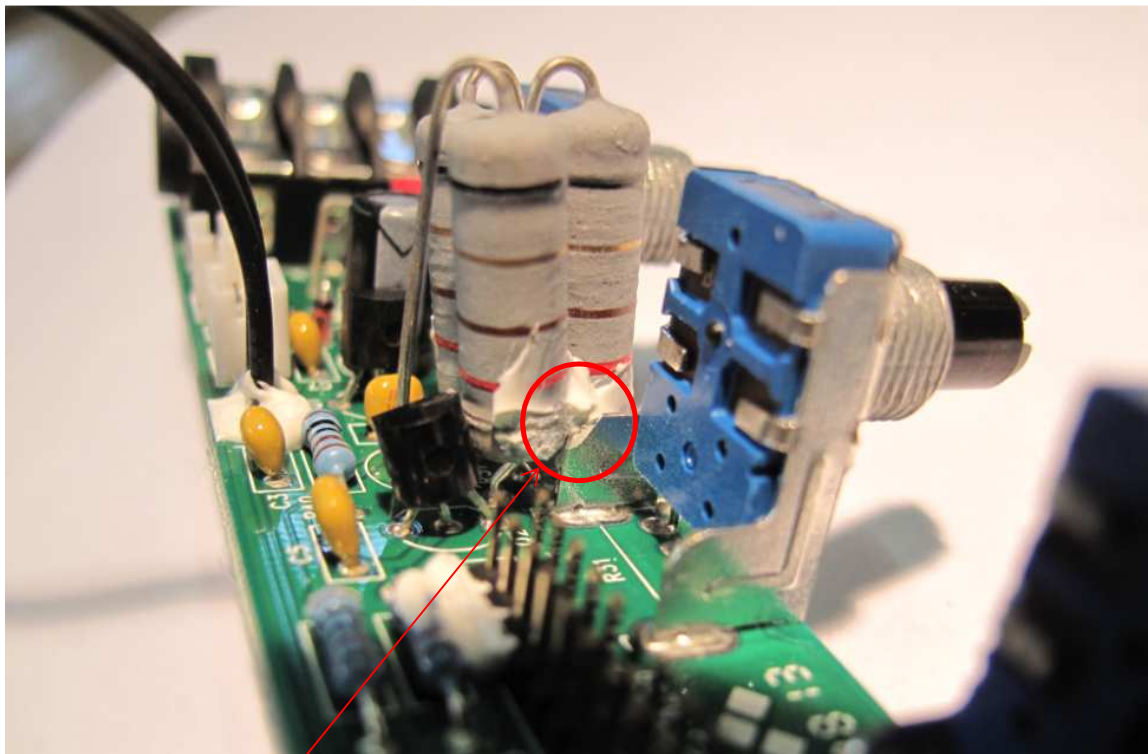

Please check that the metal housing of the potentiometer doesn't touch the resistor.

IMPORTANT:

N/A