

<b>Service Note</b>		
Product	Description:	Service note no.
<b>M3000/ P2</b>	<b>Bad Cypress SRAM revision</b>	<b>Sno-T094</b>

**Reason for note:**

We have found problems with Cypress CY7C1019DV33-10xx (AVL's J and K) on P/N E48100102. This die-revision from Cypress has increased rise/fall time on the databus compared to the other open AVL's.

**Actions:**

When all Cypress CY7C1019DV33-10xx (AVL's J and K) are used from stock on P/N E48100102 they will be discontinued.

Afterwards the above listed products must be handled as follows:

- Use **P/N 7E48100106** as a replacement for **P/N 7E48100102**

Replacement must be handled manually.

**IMPORTANT:**

This replacement should only be carried out by skilled technicians.