



Service Note		
Products	Description:	Service note no.
G-System GFX box RH450, RH750, Staccato, Classic450	PLCC socket broken	SNo-T206

Reason for note:

We have seen a few incidents where the sockets holding the flash were broken. It has been the small plate in the bottom, which were broken off. When this has happened and the flash IC is pressed all the way to the bottom of the socket is has none or bad contact to the contact springs in the socket. This can cause peculiar and weird errors, which most likely also can be intermittent. See pictures below:

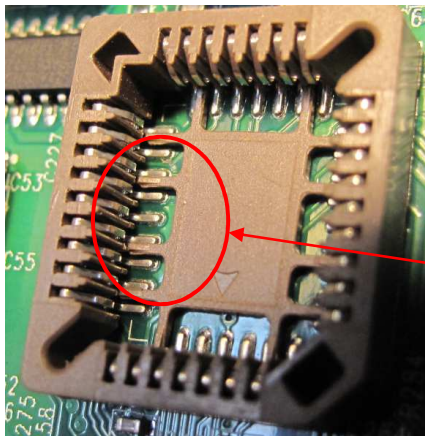

Holdes for the bottom plate are broken off.

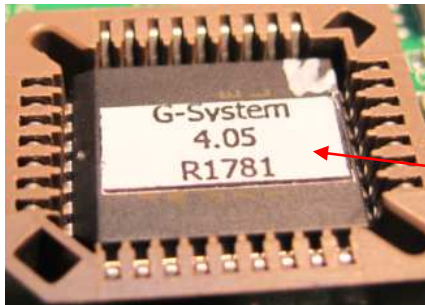

The IC pins gets poor or no contact to the socket contacts when pressed too deep into the socket

Actions:

If you have one of the mentioned products in for service with an intermittent error, it could pay of to examine this socket. The quickest repair is to place a piece of 1 mm thick tape below the flash circuit. Please notice that not all Amp main boards have the flash in a socket.

IMPORTANT:

Please handle this as a standard repair