

Service Note		
Products	Description:	Service note no.
Voicelive 3 and Voicelive 3 Extreme	Improvement of boot up reliability and stability during operation	SNo-T214

Reason for note:

We have experienced a big manufacturing spread in the Abracon crystal, which some times have made the main oscillator network unreliable. This can cause boot up problems and poor stability during operation like for instance blue screen (freeze).

Actions:

All units in for service that exhibit stability issues or need to be opened up for any other reason should have the main board modified. That is:

- X2 to be replaced with new ECS type (ECS-240-12-5PX-TR)
- C260 and C261 to be replaced with new 10 pF COG types


For part numbers please refer to the spare part lists on the Techsite

For component location on the main board please see below.

IMPORTANT:

Please handle this as a standard repair

Service Note		
Products	Description:	Service note no.
Voicelive 3 and Voicelive 3 Extreme	Improvement of boot up reliability and stability during operation	SNo-T214

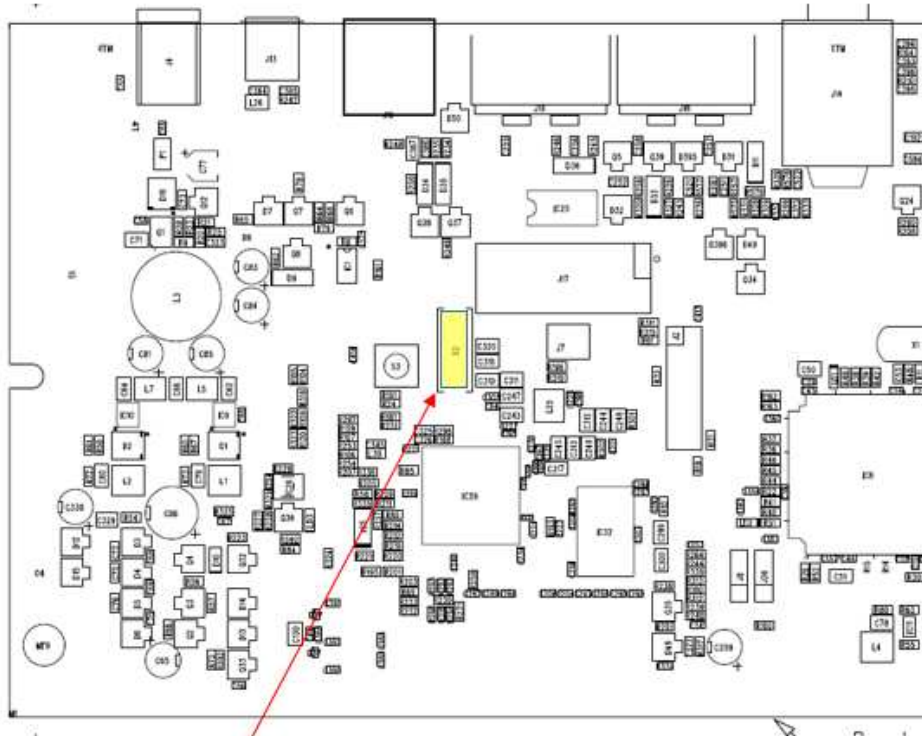

X2 is located here

C260 and C261 are located here (rear side)

