

# Service Tips C12

**Created by: Lab.gruppen AB Service Department**  
**Reference no: C12**

## Affected models

Following models are affected by this technical service tips

FP+.

C16:4, C28:4, C48:4, C68:4, C88:4.

PLM10000Q, PLM14000.

## Affected boards/modules

SP100FXXx-FXX

SP130FXXx-FXX

SP140F01a-FXX, SP140F01b-FXX

## Symptom

Screaming sound from power supply if amplifier powers up.

Amplifier does not power up.

## Solution

Replace capacitor C12 with either of below listed components.

Lab Part No.	Description	Amount	Info	Pos
6n8250VMMK5	Wima: FKS2 6800PF 10% 400VDC	1		C12
6n8250VMMK5	Epcos: B32529-C3682-K289	1		C12

