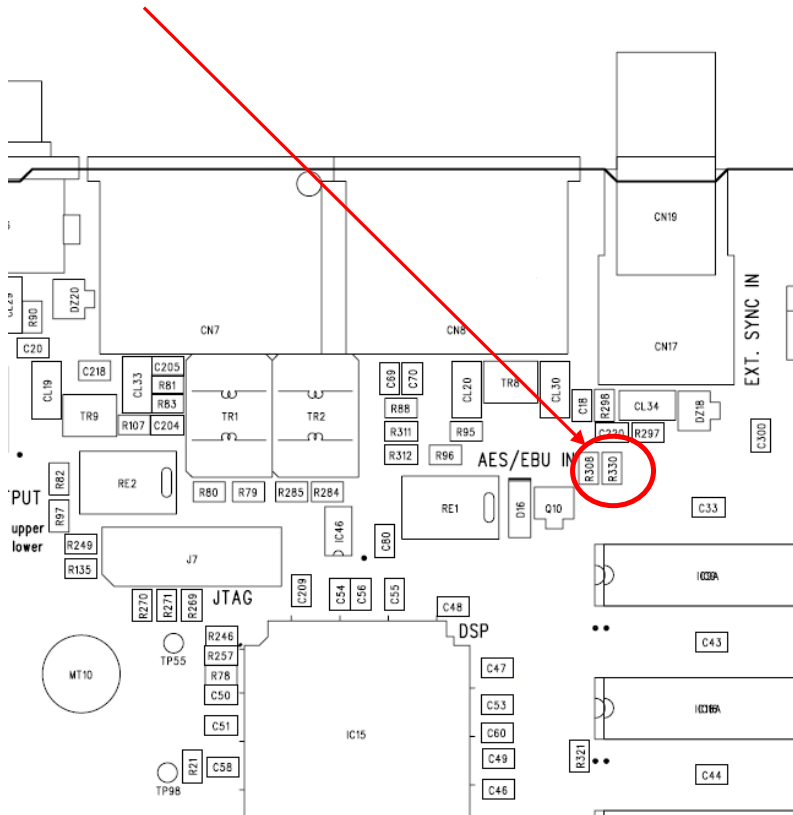**Reason for note:**

Resistor for base on transistor for bypass relays must be reduced to ensure that the transistor is properly switched on and thereby switch on both digital (AES/EBU) relays properly.

The error shows as missing AES/EBU signal IN and/or OUT.

Eventhough we only have seen a few of these errors it is a critical error and we want to make a fix for this on all mentioned products when in for service. Also if the product is in for another reason

Actions:

Change R330 to a 1k1.

IMPORTANT:

This repair should only be carried out by skilled technicians.