

Service Note		
Product	Description:	Service note no.
VPD	Diodes mounting error	750 10 T007

IMPORTANT:


Modification should only be carried out by authorized technicians.

The serial number range is: 109000 - 109499

Symptoms: LD1, LD2 and LD3 Diodes mounted too high above the PCB print resulting in diodes braking down.

Remedy: Lower diodes LD1,LD2 and LD3.

- 1) Un-mount the PCB from the VPD pedal.
- 2) Locate the diodes LD1, LD2 and LD3 fig.1.

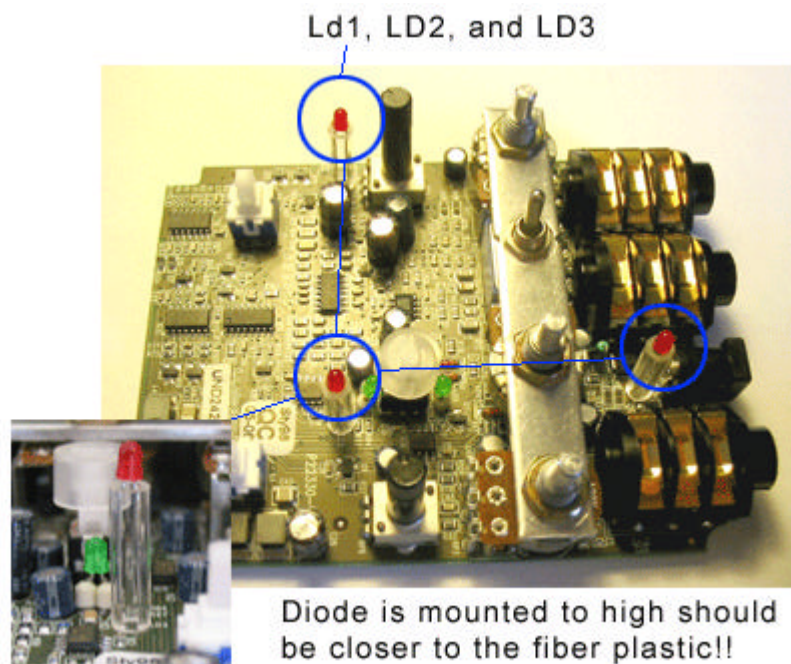

- 3) Lower and resolder these diodes.
- 4) Mount the VPD and start jamming.