


Service Note		
Product	Description:	Service note no.
Lucia	Amplifier channels swapped	SNo-T201

Reason for note:

We have seen a few incidents where the amplifier channels in a Lucia product have been swapped. That means Channel 1 by accident is connected to Output 2 and vice versa.

Actions:

To fix this error the 4 wires have to be relocated as shown below:

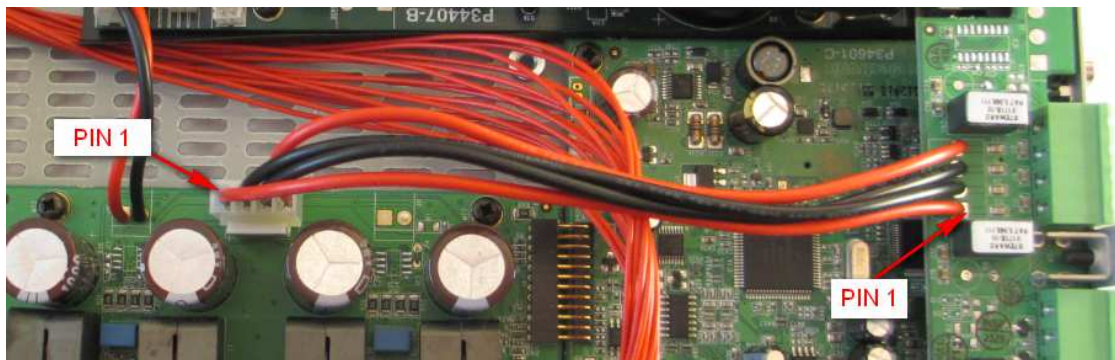

The correct mounting of the wires. Pin 1 to pin 1. 2 to 2, 3 to 3 and 4 to 4. That can be done either by unsoldering the wires for relocation or to unplug and replace in the connector.

IMPORTANT:

This repair should only be carried out by skilled technicians.

Please handle this as a standard repair