
Service Note		
Product	Description:	Service note no.
Motofader64	Display error	795 10 1813

IMPORTANT:

Modification should only be carried out by authorized technicians.

Symptoms: Due to possible overloading of the display backlight on the Motofader64, a current limiting resistor must be added. The modification is done on the display module according to attached description/drawing.

Remedy: Units received for service must be reworked with a new modified display. **Please scrap old display because of possible damage.** No change in schematics.

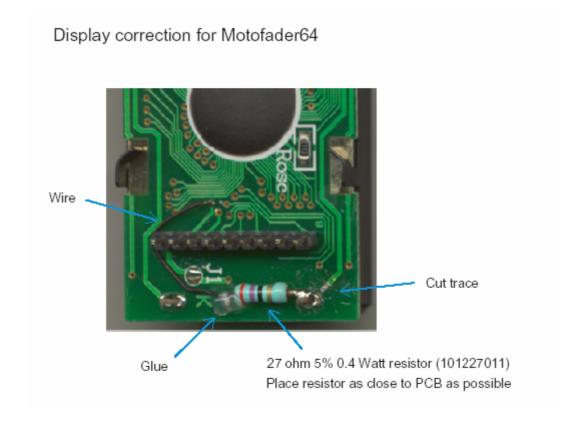

Filename: SNo_1818 Date: 06-02-2008