


Service Note		
Product	Description:	Service note no.
Nova Drive	Coils, L3 and L5 overheats	SNo-T0122

Reason for note:

In some cases L3 and L5 overheats

Actions:

When a Nova Drive is in for service these two coils must be exchanged from the original 150 uH, 420mA to 33uH, 900 mA

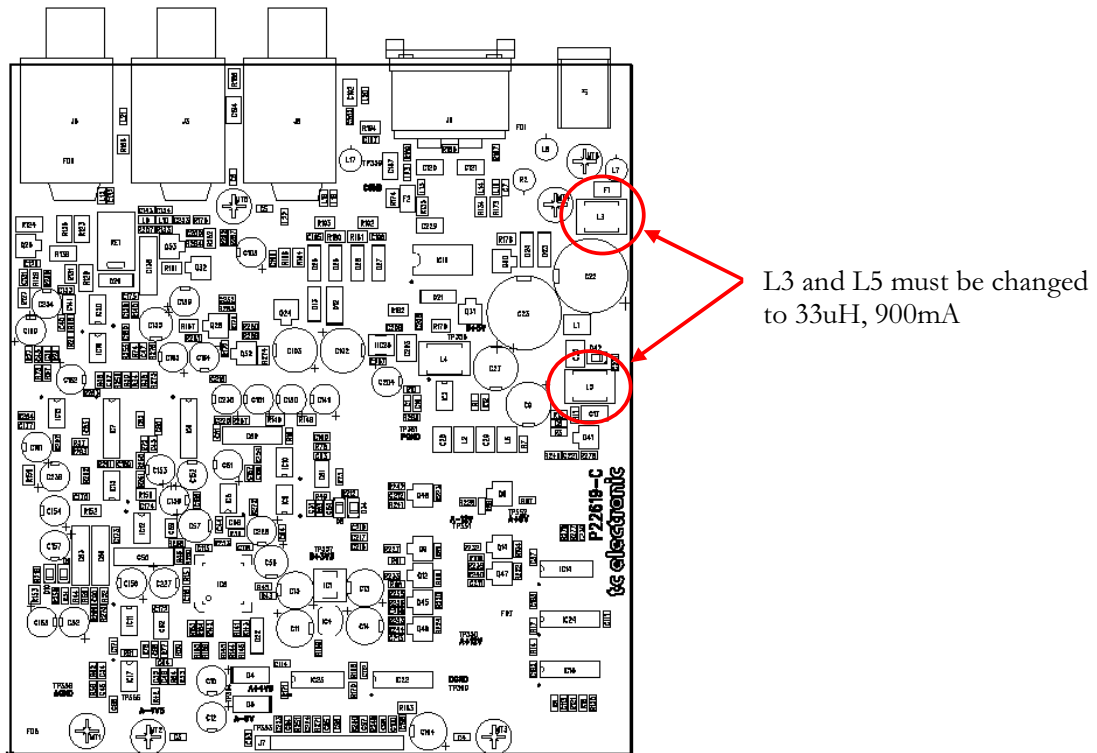

IMPORTANT: This replacement should only be carried out by skilled technicians.