
Service Note		
Product	Description:	Service note no.
TC2290	Fuses On TC2290 Main Board:	706 10 T066

IMPORTANT: When having 2290s with s.no. lower than 512020 for repair or service please make this correction.

Solution:

In order to avoid the two secondary fuses F2 and F3 to blow when extreme high tension accrues on the power network, please replace these fuses with a 400mAT type. The fuses are placed just beside the transformer on the main board.

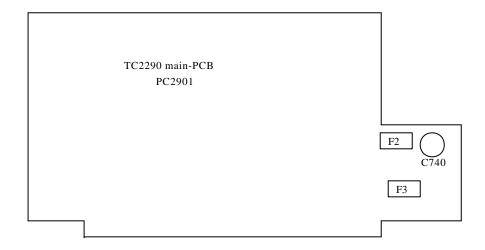

Filename: SNo_T066.doc Date: 11-04-2007 ID:Thsig