

Service Note		
Product	Description:	Service note no.
Remote CPU	Old Flash RAM card does not work with newest software	SNo-T0151

Reason for note:


A Remote-CPU with "old" Flash RAM-card (32MB) cannot contain the newest application software (5.04 or newer) needed to work with the System6000MKII frame.

Actions:

This is easily fixed by replacing the Flash RAM-card to the new type: 712016701

The type of Flash RAM-card in the Remote-CPU can be seen during boot.

Turn on the Remote-CPU, on the ICON screen you can see the Flash RAM-card version (see attached picture)

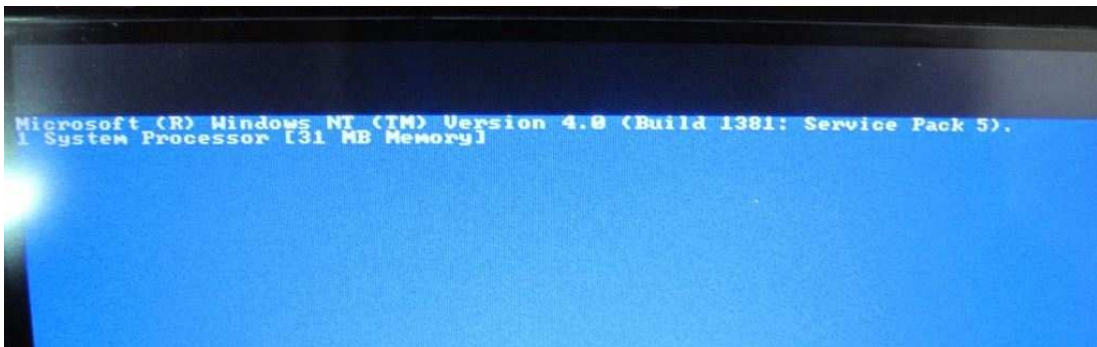

IMPORTANT:

This repair should only be carried out by skilled technicians.