

Service Note		
Products	Description:	Service note no.
VoiceSolo FX150	Improvement for audio quality	SNo-T208


Reason for note:

Some customers have experienced issues with buzzing or low frequency speaker noise

Actions:

If a product comes in for service with symptoms like above mentioned the problem can most likely be solved by exchanging L7 and L12 in the power amplifier section with ultra low ohmic resistors.

For a Music Group part number, please refer to the spare part list

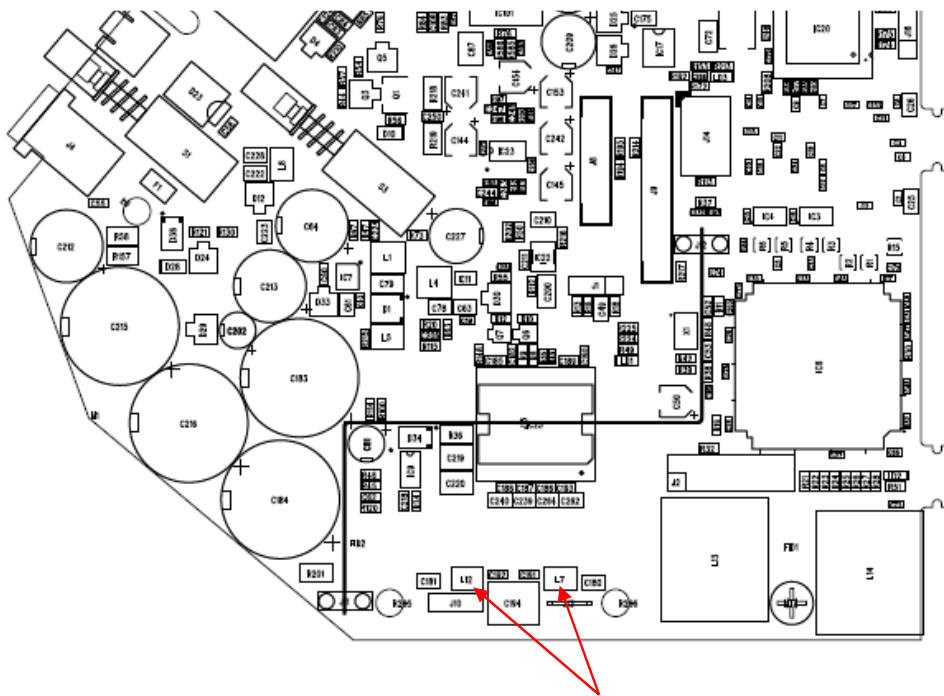

Placement of L7 and L12

IMPORTANT:

Please handle this as a standard repair