

Technical Service Bulletin No. 36

Created by: Lab.gruppen AB Service Department

Date: 2015-06-04

Reference no: Missing support post

Affected models

Following models are affected by this technical service bulletin:

IPD1200

IPD2400

Affected boards/modules

ADIC-01Ac

ADIC-01-F01

ADIC-01-F02

Symptom

The DSPB board can jump out of its position from the ADIC-board, making a malfunction on the unit

Solution

Make a visual check to see if the support has been mounted.


Mount the support if it is missing

Note


Part numbers

Model	Part number
IPD1200	DLSP-32143
IPD2400	DLSP-32143


1	Do a visual check and see if the support post is mounted (see orange arrow)	
---	---	--

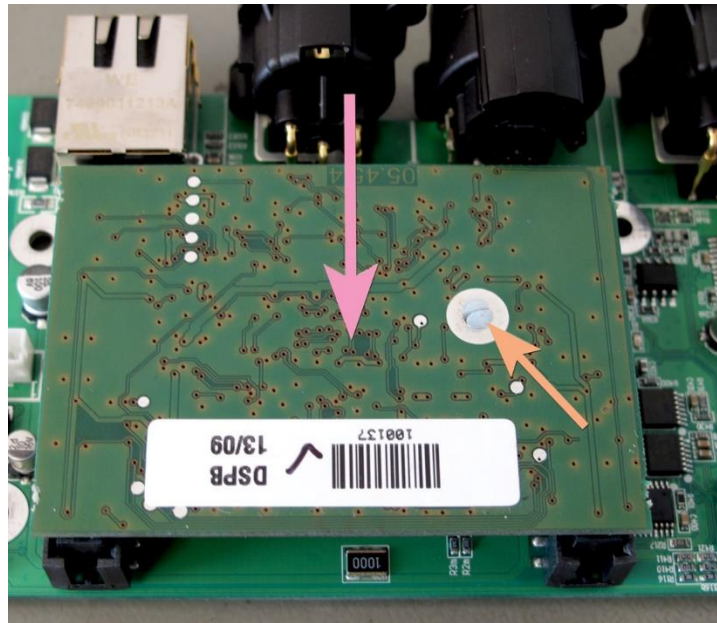


2	Picture of the support post	
---	-----------------------------	--

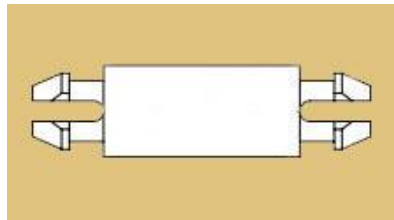

3	Dismount the DSP board and then mount the support post (see pink arrow)	
---	---	--

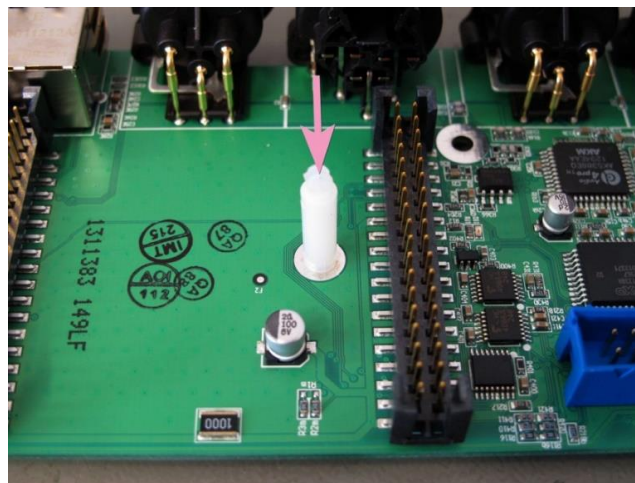

4	Mount the DSP-board back on to the ADIC board	
---	---	--

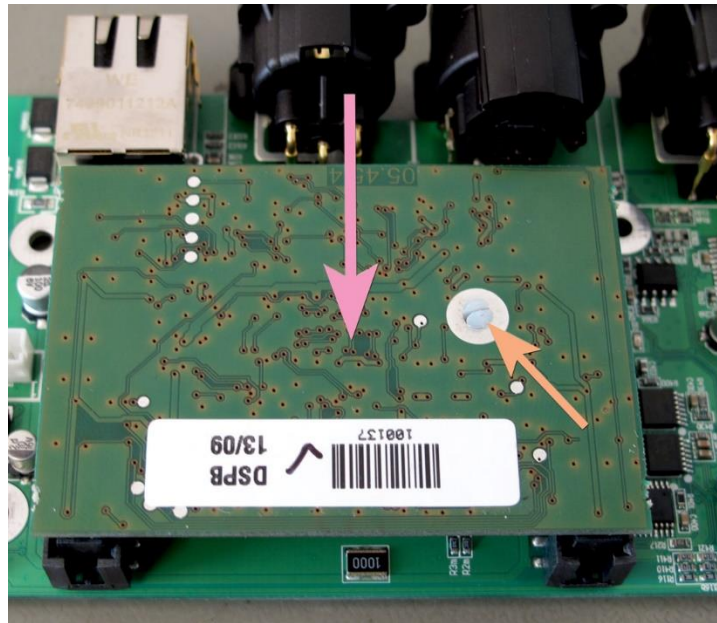

DONE

Write "Technical Service Bulletin no.36" in the service repair report form, column "Repair Remedy" besides other normal repair information

History

Date	Created By	Status	Bulletin no.	Comment
2015-06-04	ALRIQ	Sharp	36	