


Service Note		
Product	Description:	Service note no.
BH500 Powerboard	Condensing sensitivity	SNo-T138

Reason for note:

Powerboard P18412-Bxx is sensitive to condensation which can trigger the overcurrent protection. To improve this issue, a procedure is implemented where lacquer is sealing the sensitive control components. Products with serial number 11376941 and forward have had the Powerboard lacquered from the factory. Some products with lower serial numbers might also have been lacquered, but if not the board must be lacquered when the product is in for service.

Actions:

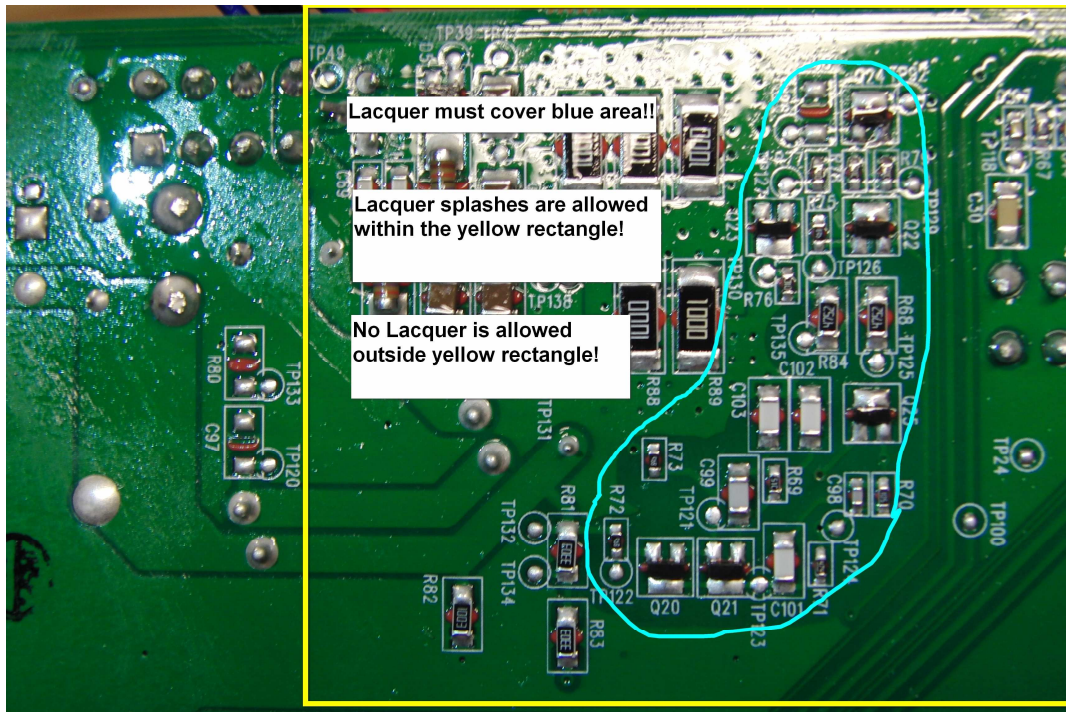

Note : a bit of lacquer splash are accepted within the yellow region.

Lacquer type : 1B73 Acrylic Coating, UL number E 105698, www.humiseal.com, Thickness : 100-300u meter.

IMPORTANT: