
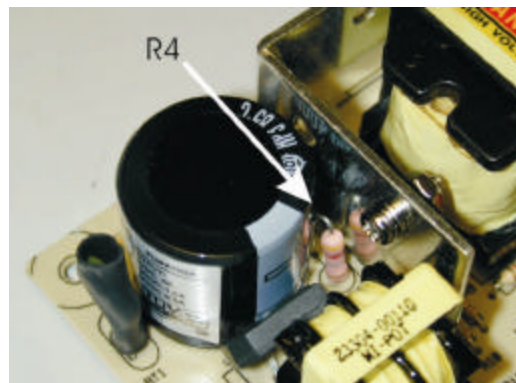


Service Bulletin

Date Issued	03 April 2001
Products Covered	VoicePrism serial number < 7002251
Issue	Some power supplies on early units of VoicePrism do not meet the IEC standards with respect to transformer temperature in condition of a direct short of the -Vout rail. This issue concerns units operated at 220VAC or higher.
Description	<p>R2 was a 120 K resistor and should be 220K to limit short circuit current. Ensure insulator on lead is replaced on new resistor before installation.</p> <p>R4 has always been specified as a 0.5 ohm but some early units have been found with 0.42 ohm resistors and must be modified.</p> <p>VoicePrism units with serial numbers less than 7002251 are affected. Units with serial numbers greater than this have been modified by ECO1264</p>

Details:

Part	Specification
R2	220K ohm 5% 2W ceramic wirewound
R4	0.5 ohm 5% 1W ceramic wirewound

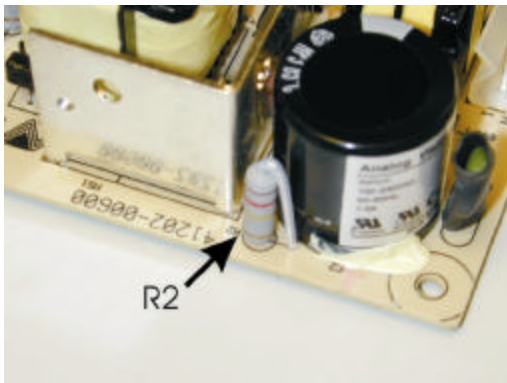

TC Electronic A/S
 Sindalsvej 34
 DK-8240 Risskov
 Denmark

Phone: +45 8742 7000 Fax: +45 8742 7010 E-Mail: www.service@tcelectronic.com
www.tc-helicon.com