

Service Note		
Products	Description:	Service note no.
Harmony Singer 2, Mic Mechanic 2, Duplicator, Critical Mass, Talkbox Synth	Power supply startup failures	SNo-T222


Reason for note:

We have seen some of these products being unable to start up with the new TC branded 9V power supplies

Actions:

To fix this problem the through-hole inductor L12 on the front PCBA, must be replaced with a through-hole resistor (4R7 0.4W 5% metal film) to provide reliable starting.

Location of L12

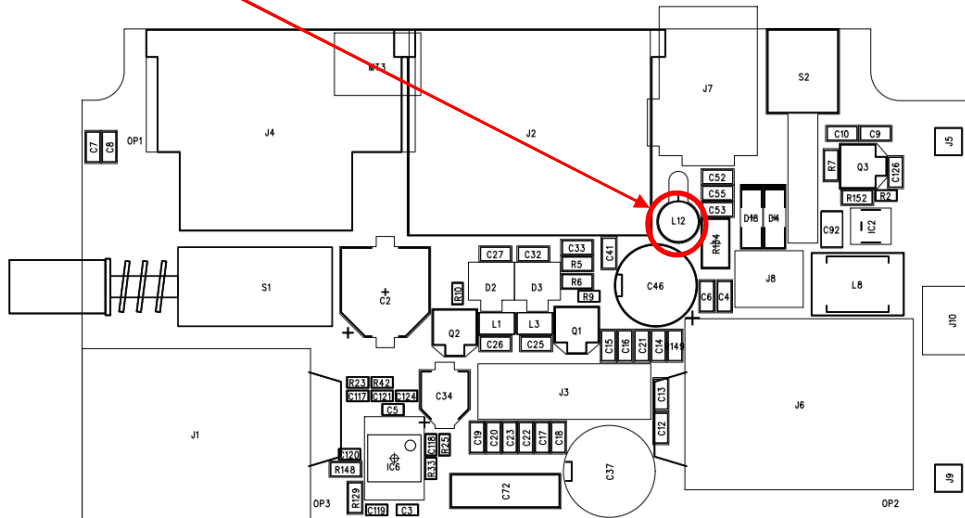

IMPORTANT:

This repair should only be carried out by skilled technicians.