

Service Note		
Product	Description:	Service note no.
G-Force, DBMax, M2000, M3000, D22, Fireworx, P2, Finalizer Express, DB2	Display error	SNo-T0154


**Reason for note:**

Display errors caused by a loaded CPU clock have been observed. The error can be seen as corrupted characters.

This is for Wizards with mainboard P13006 (M2000, M3000, Fireworx, Finalizer Express, G-Force, DB2, D22, P2 and DBMax)

**Actions:**

This problem can be eliminated by removing C232 on the Wizard mainboard.

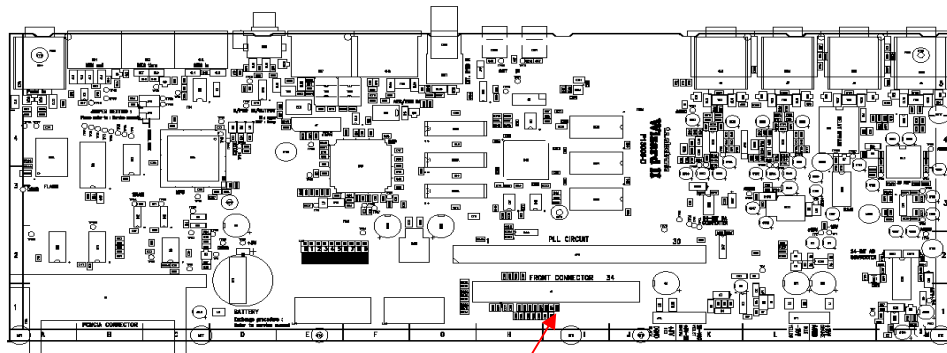

C232 to be removed

**IMPORTANT:**

This repair should only be carried out by skilled technicians.