

Service Note		
Products	Description:	Service note no.
BH550 and BH800	Check value of R29 if fan or main board is replaced	SNo-T221

Reason for note:


When replacing the fan or the mainboard you have to check the manufacturing part number of the fan and the value of resistor, R29.

Actions:

Check the marking on the fan.

If it is a Sunon - ME50152V1-000C-A99, R29 must be a 82 ohm/3W. Replace if necessary.
 If it is a Sunon - MF50152VX-1000C-A99, R29 must be a 240 ohm/3W. Replace if necessary.

R29 is situated here

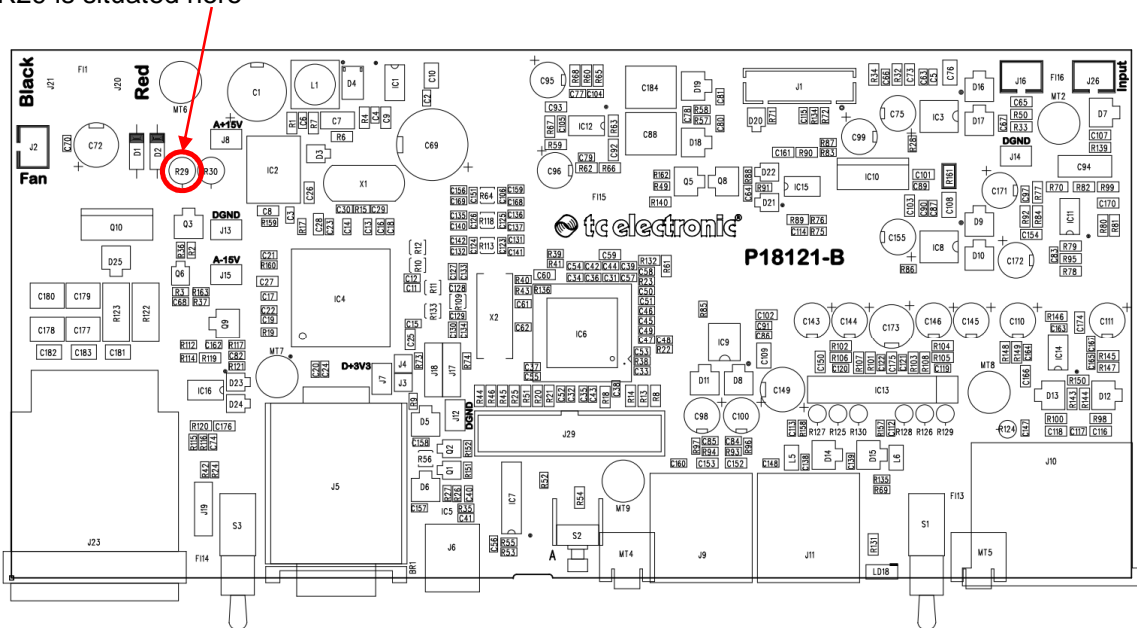

IMPORTANT:

This repair should only be carried out by skilled technicians.