




VoiceLive Service Bulletin

Problem: Display contrast- display looks too dark, not readable.

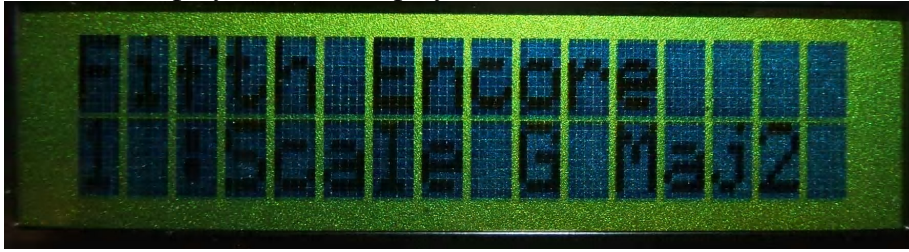


Solution:

- 1. remove 4 screws as indicated below and remove blue display plate.



- 2. Replace R31 with resistor, 0805, 3.9K as shown below:

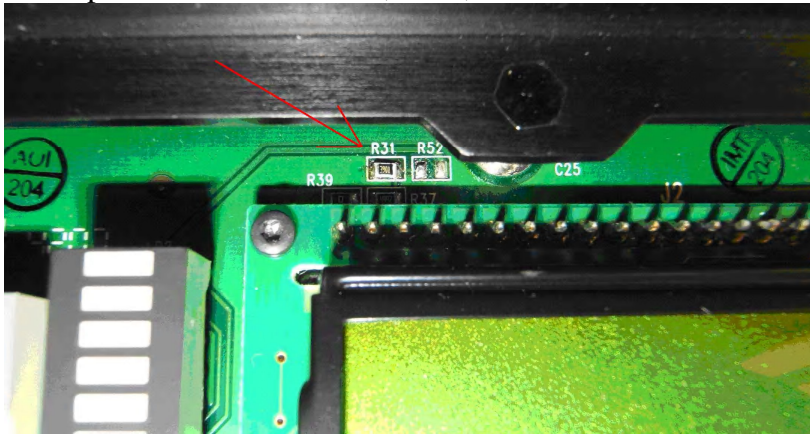

- 3. Power up and verify that the display contrast is acceptable.
- 4. Re-assemble. The display should look as below:



Administration office:

TC-Helicon Vocal Technologies Inc.
c/o Tannoy North America, Inc.
335 Gage Avenue
Kitchener, ON N2M 5E1 / Canada

Phone: +1 (519) 745-1158
Fax: +1 (519) 745-2364
Mail: info@tc-helicon.com
www.tc-helicon.com

Operations Office:

TC-Helicon Vocal Technologies Inc.
1075 Pendergast Street, Suite 204
Victoria BC V8V 0A1
Canada

Phone: +1 (250) 483-5002
Fax: +1 (250) 483-5004

